



Instrucciones de instalación / Mounting instructions:

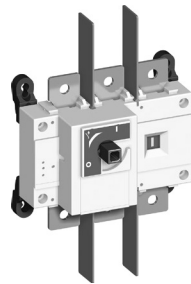


55HAC3020
55HAC3040

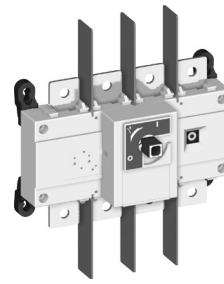


55HAC4020
55HAC4040

Interruptor y accesorios / Switch and accesories


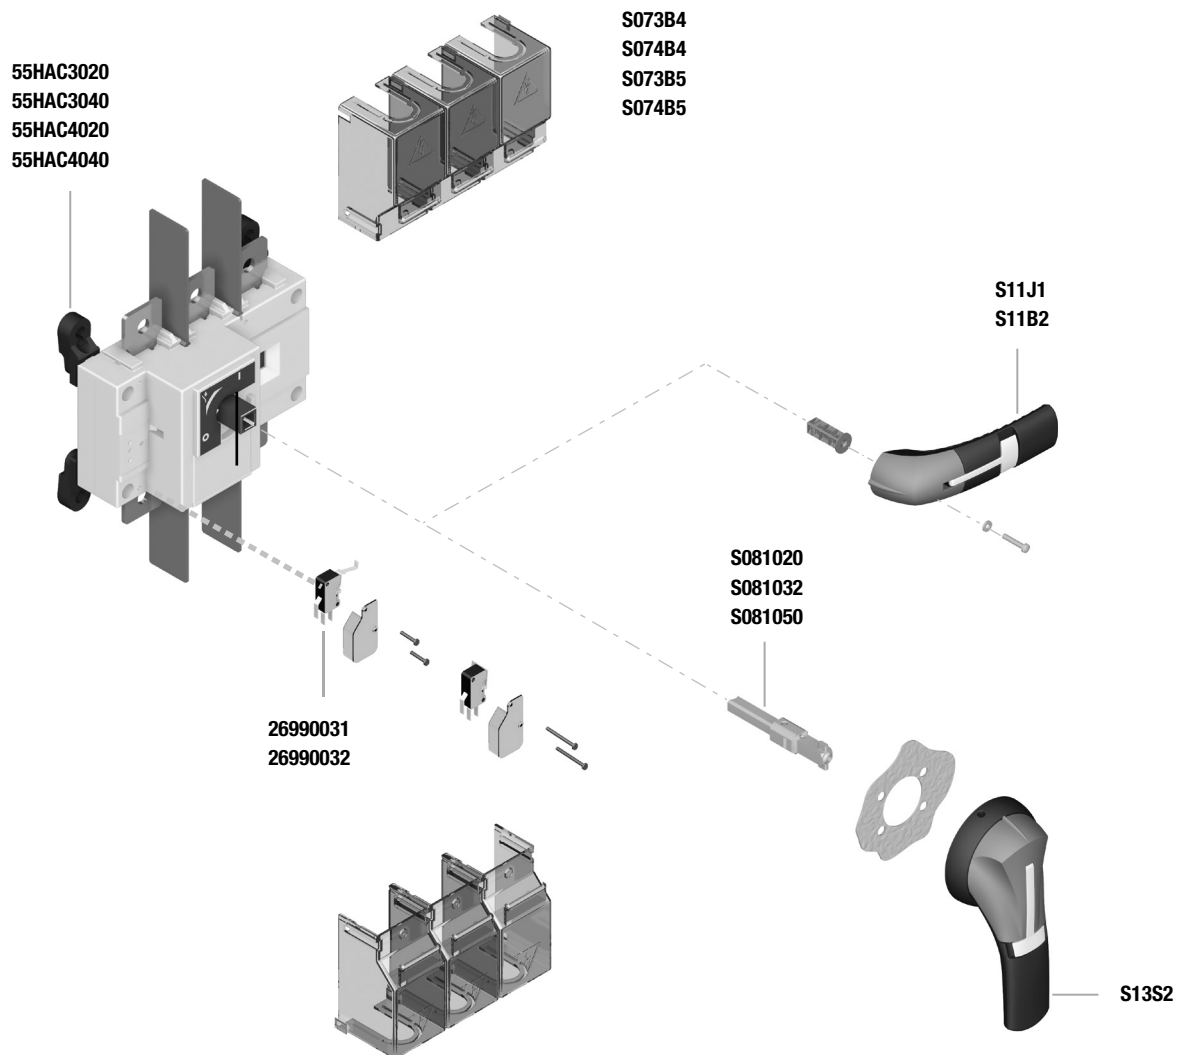


Dimensiones (in/mm) / Dimensions (in/mm)

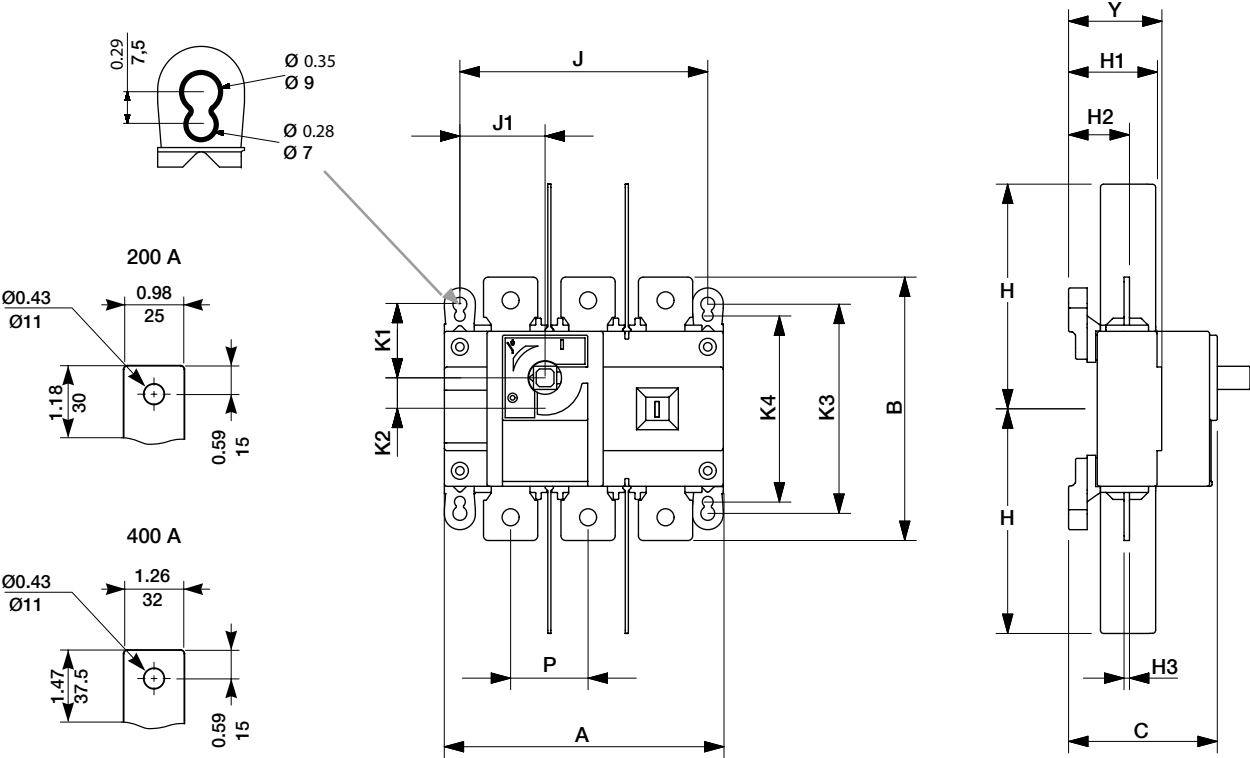


	A		B		C		H		H1		H2		H3	
	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm
55HAC3020	7.09	180,00	6.30	160,00	3.74	95,00	5.71	145,00	2.17	55,00	1.51	38,30	0.14	3,5
55HAC3040	9.06	230,00	9.25	235,00	5.02	127,40	7.87	200,00	3.24	82,40	2.06	52,40	0.19	4,8
55HAC4020	9.06	230,00	6.30	160,00	3.74	95,00	5.71	145,00	2.17	55,00	1.51	38,30	0.14	3,5
55HAC4040	11.42	290,00	9.25	235,00	5.02	127,40	7.87	200,00	3.24	82,40	2.06	52,40	0.19	4,8


	J		J1		K1		K2		K3		K4		P		Y	
	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm
55HAC3020	6.30	160,00	2.17	55,00	1.87	47,50	0.79	20,00	5.31	135,00	4.72	120,00	1.97	50,00	2.32	59,00
55HAC3040	8.27	210,00	2.95	75,00	2.66	67,50	1.18	30,00	7.68	195,00	7.09	180,00	2.56	65,00	3.52	89,40
55HAC4020	8.27	210,00	4.13	105,00	1.87	47,50	0.79	20,00	5.31	135,00	4.72	120,00	1.97	50,00	2.32	59,00
55HAC4040	10.63	270,00	5.31	135,00	2.66	67,50	1.18	30,00	7.68	195,00	7.09	180,00	2.56	65,00	3.52	89,40

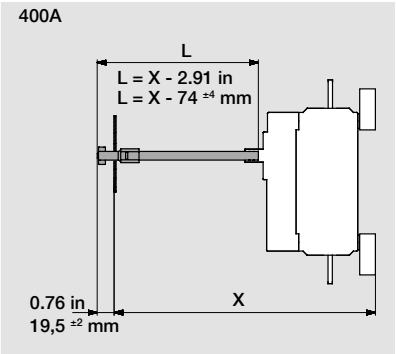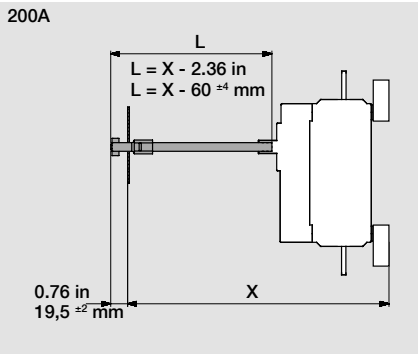


Montaje del mando / Mounting of handles

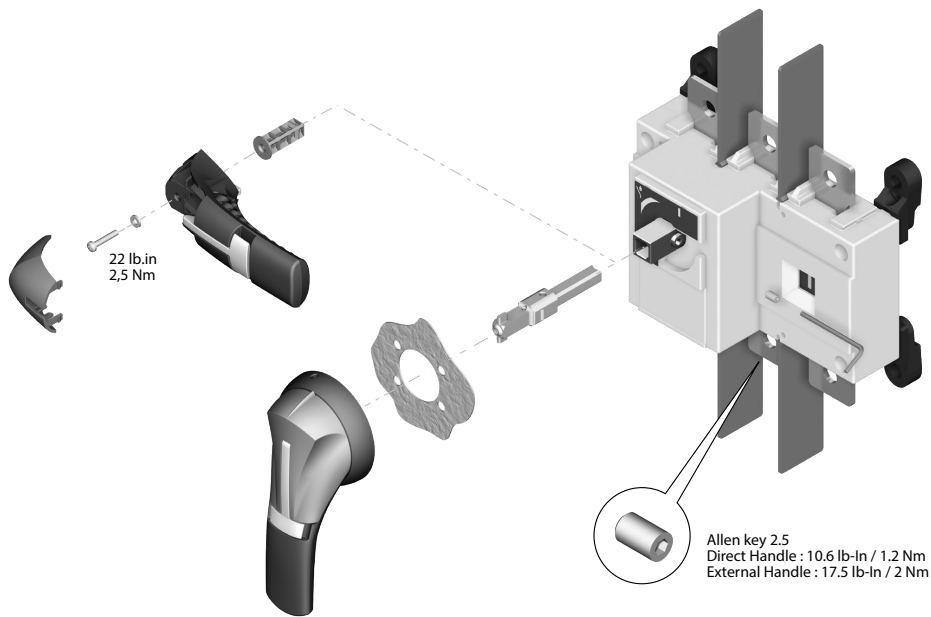


Montaje de los cubrebornes / Mounting of terminal covers

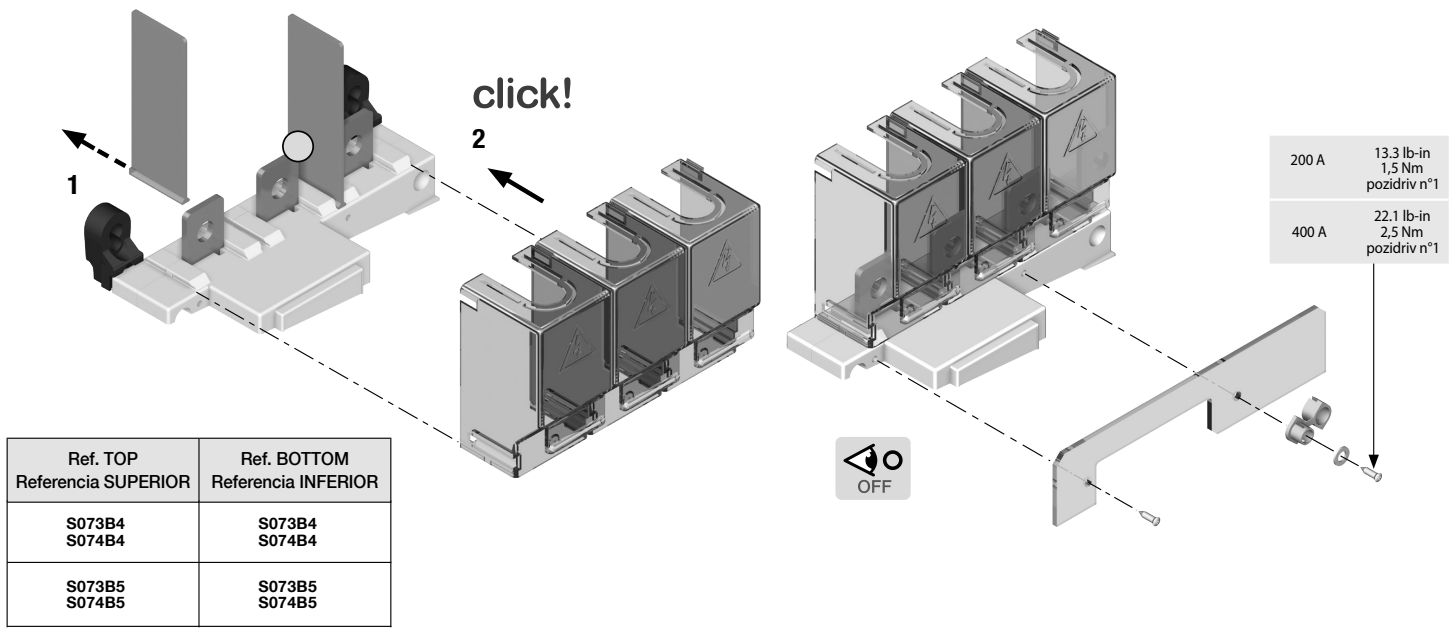

Sentido de montaje / Mounting orientation

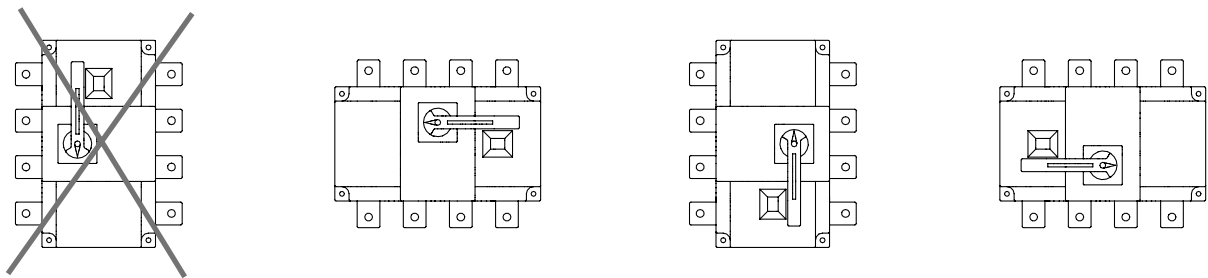

Montaje de los contactos auxiliares/ Mounting of auxiliary contacts

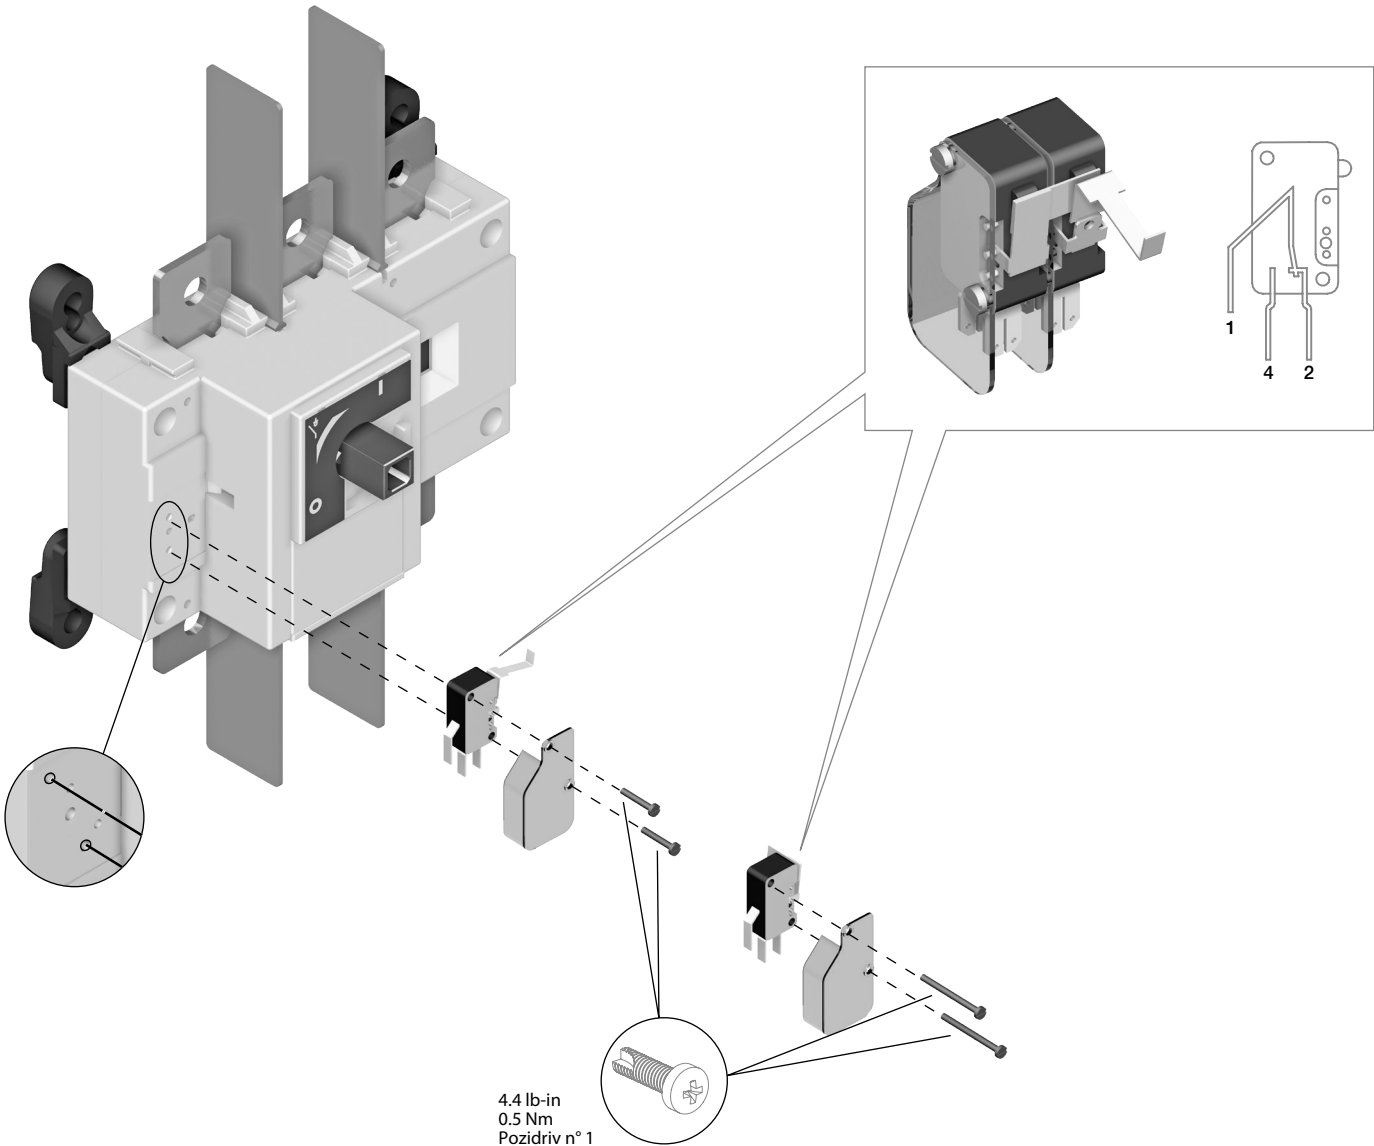

		Nominal Cu cable section Cu Sección máx. de cables de cobre rígidos	Min./Max. tightening torque Par de apriete mini./maxi.
55HAC3020 55HAC4020	200 A	95 mm ²	20 Nm / 26 Nm
55HAC3040 55HAC4040	400 A	240 mm ²	

⚠ PELIGRO / DANGER

TENSIÓN PELIGROSA Únicamente el personal de mantenimiento eléctrico especializado deberá instalar y prestar servicios de mantenimiento a este equipo. Cortar la alimentación del equipo antes de realizar cualquier trabajo en él. Utilice siempre un dispositivo detector de tensión adecuado para confirmar la falta de tensión en el equipo. Vuelva a colocar todos los dispositivos, las puertas y las cubiertas antes de poner el equipo en tensión. El incumplimiento de estas precauciones podrá causar la muerte o lesiones graves.

HAZARDOUS VOLTAGE This equipment must be installed and serviced only by qualified electrical personnel. Turn off all power supplying this equipment before working on or inside equipment. Always use a properly rated voltage sensing device to confirm power is off. Replace all devices, doors, and covers before turning on power to this equipment. Failure to follow these instructions will result in death or serious injury.